




① BOX UNFOLDED, PAPER TWINE IN PLACE. LAY FLEECE FLESH SIDE DOWN WITH CLEAN TAGS & LOOSE ENDS IN THE CENTER.

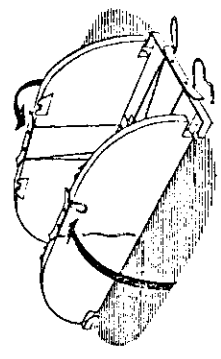

② RAISE & HOLD SIDES


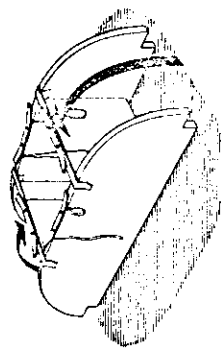


③ RAISE ENDS, CLOSING AND LOCKING THE BOX. TIE FLEECE.

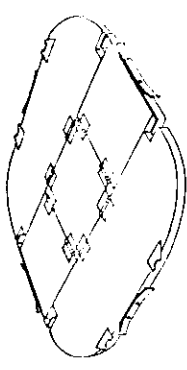

④ RELEASE ENDS, UNFOLDING BOX. WEIGH, TAG, AND PACK FLEECE IN WOOL BAG.

OPERATION OF THE WOOL BOX

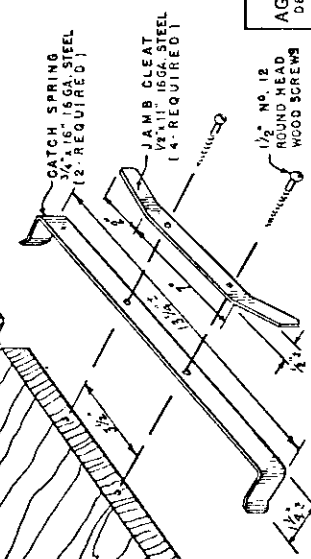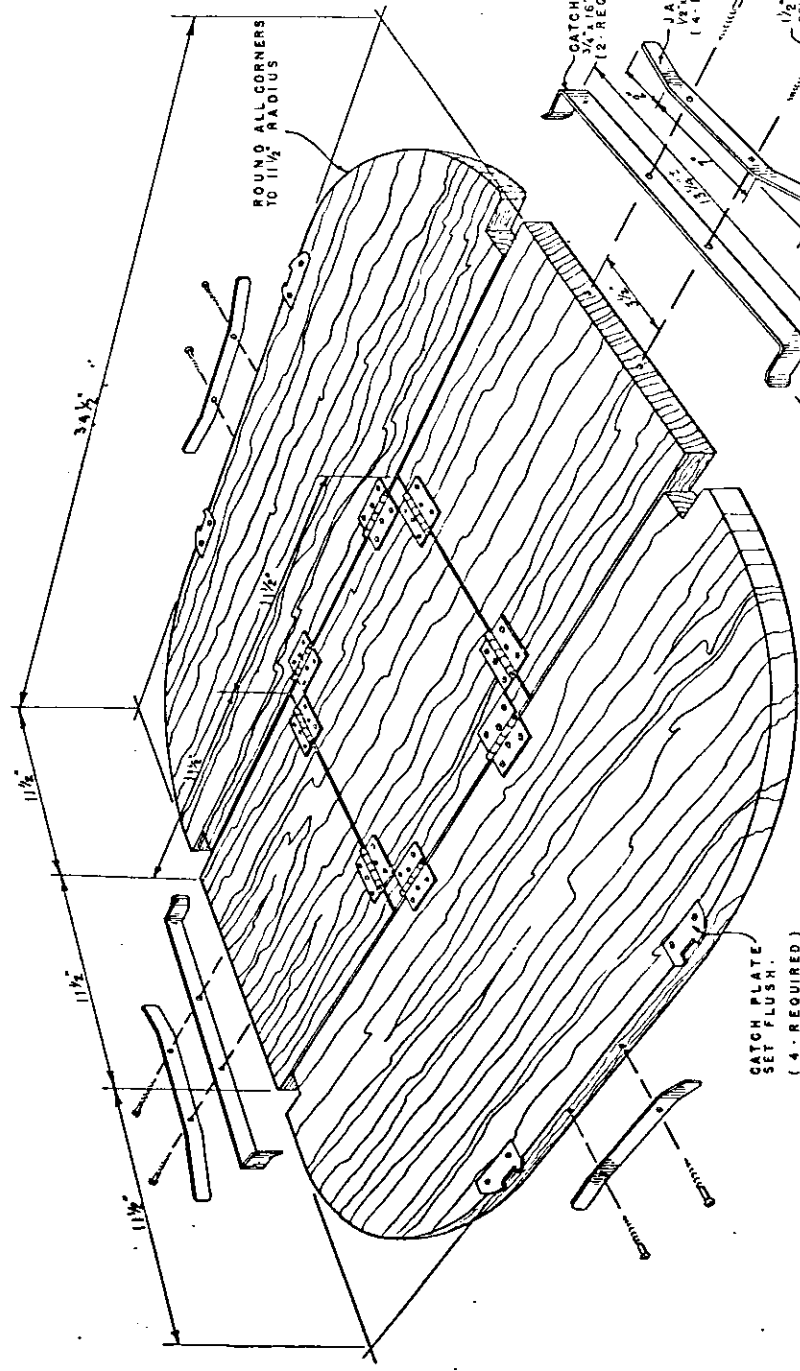

1/2" No. 12 ROUND HEAD WOOD SCREWS

CATCH PLATE SET FLUSH. (4 - REQUIRED)

NOTES:  
 1. DIMENSIONS SHOWN ARE BASED ON USE OF STANDARD 1 1/2" LUMBER DRESSED. THIS IS ADEQUATE FOR FLEECES OF 8 TO 10 POUNDS.  
 2. THE PLAN MAY BE MODIFIED AS DESIRED TO SUIT INDIVIDUAL PREFERENCES.  
 3. ALL WOOD PARTS SHOULD BE SAVED & BURNERS SMOOTHLY ROUNDED TO REMOVE ALL CORNERS & BURRS FROM METAL PARTS TO AVOID SNAGGING WOOL.  
 4. TIE FLEECES WITH PAPER TWINE ONLY.

PLAN EX. 5806 SHOWS DETAILS OF A WOOL PACKING RACK WHICH HOLDS THE WOOL BAG IN A CONVENIENT POSITION.

COOPERATIVE EXTENSION WORK IN AGRICULTURE AND HOME ECONOMICS  
 DEPARTMENT OF AGRICULTURAL ENGINEERING  
 UNIVERSITY OF MARYLAND

UNITED STATES DEPARTMENT OF AGRICULTURE COOPERATING

WOOL BOX  
 FOR TYING FLEECE

MASS. '55 EX. 5805 SHEET 1 OF 1

CUTTING & ASSEMBLY DIAGRAM

